

Work Order ID 137559

Tuesday, October 06, 2015 12:41:55 PM

137559

U/R

Page 1

Item ID: D119-646-041

Accept

N900040100

Setup Start

NS1

Revision ID: URF15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop

NS2

Start Date: 11/16/15 Start Qty: 1.00

1

Cust Item ID:

O.K TO SHIP. A.P.

Required Date: 11/27/15 Req'd Qty: 1.00

1

Customer:

15.10.06

Reference:

Approvals:

Process Plan:

[Signature]

Date: 15-10-06

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr	Revision Nbr
D3887-041	D
IIN-D119-646	C

100

0.00

100

DC

Doc.Control -USB or Paperwork

Memo

0.00

Photocopy bluefile & type labels per PPP D119-646-041

CHG003

N/A MWS

JAN 12 2016

110

0.00

110

Skidtubes

Skidtubes

Memo

0.00

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

[Handwritten signature] 15-10-7

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 137559***137559***

Page 2

Tuesday, October 06, 2015 12:41:55 PM

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/27/15 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

Chemical Conversion Coat per QSI005 4.1

0.00

120

HandFinish

Memo

0.00

Hand Finishing

1	0	15-10-07	
---	---	----------	---

121

QC7-Inspect Chemical Conversion Coat

0.00

121

QC

Memo

0.00

Quality Control

1	0	15-10-07	
---	---	----------	--

122

QC5- Inspect part completeness to step on W/O

0.00

122

QC

Memo

0.00

Quality Control

1	0	15-10-07	
---	---	----------	--

DAS
18
9-89DAS
18
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 137559

Tuesday, October 06, 2015 12:41:55 PM

137559

Page 3

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/27/15 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

0.00

130

Skidtubes

0.00

Skidtubes

Memo

1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.

2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.

3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477

4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***

5- Deburr, blow out chips from inside of tube.

6- Bond web in place as per Dwg D3887 & OSI 016.

A/RSikaflex-291 133136Sikaflex expire date: 10-2-12Start: 8:50 Time: _____Finish: 8:50 Time: _____

***** (Adhere for 12 hours) *****

15-10-8
JH

15-10-7

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____ Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : ☐							

Work Order ID 137559

Tuesday, October 06, 2015 12:41:55 PM

137559

Page 4

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 11/16/15 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/27/15 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

135

QC5- Inspect part completeness to step on W/O 0.00

135

QC

Memo

0.00

Quality Control

DAS
18
9-891 0 1540-13

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 137559

Tuesday, October 06, 2015 12:41:55 PM

137559

Page 5

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/27/15 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

0.00

140

0.00

Skidtubes

Memo

1- Bend FWD end of tube using bender 1 and bend prog. D3887.***Must use bending aid DT9544, ensure proper positioning***

2- Cut FWD end of tube as per dwg D3887.***Verify measurment***

3- Buff out marks left from bending

4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"

5- Open FWD saddle holes to finished size as per dwg D3887

6- Drill FWD x-bolt spacer holes using DT9816 and open to finished size.(verify measurement)

7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify neasurement). Open to finished size.

8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg.

9- C'sink FWD cap hole as per detail "C"

10- Drill holes for wearpads using DT8931, open to 0.297".

11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.

12- Deburr and blow out chips from inside of tube.

15-1013
AK

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engine ☐ QI ☐			
Date : _____	Step #: _____	QTY Effective : _____			MRB (QSI04) _____
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor Approval Verification
					QC / QA Coordinator Approval
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Work Order ID 137559

Tuesday, October 06, 2015 12:41:55 PM

137559

Page 6

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/27/15 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

QC5- Inspect part completeness to step on W/O 0.00

150

QC

Memo

0.00

Quality Control

DAS
18
9-891 0 15-10-15

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 137559

Tuesday, October 06, 2015 12:41:55 PM

137559

Page 7

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 11/16/15 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/27/15 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

0.00

160

Skidtubes

Memo

0.00

NOTE: TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD
GROUND HANDLING FIXTURE, IF FIXTURE FITS WELL THEN
PROCEED. FIXTURE DT10091.

1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to
back drill each hole before welding the other side. Use aluminum rod
A/R Aluminum Rod m32917

2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.

3-Counterbore 5/16" x 0.750" deep as per Dwg D3887.

4- Debur & Scribe batch # on Aft end of tube.

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Quality Control

Memo

0.00

TEST FIT USING FIXTURE DT10091.

DAS
38
9-89

OCT 20 2015

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

Work Order ID 137559


Tuesday, October 06, 2015 12:41:55 PM

137559

Page 8

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 11/16/15 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/27/15 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

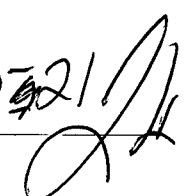Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180 *180* QC Quality Control	QC10- Inspect visual per QSI004- ground welds Memo	0.00 0.00				<u>1</u>			DAS 38 9-89 OCT 20 2015
190 *190* HandFinish Hand Finishing	Pressure Wash per QSI005 4.3 Memo Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.	0.00 0.00				<u>1</u>		<u>15-10-21</u>	
200 *200* Powdercoat Powder Coating	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum <u>m 133428</u> Memo START TIME: <u>10:00</u> OVEN TEMPERATURE: <u>325</u> FINISH TIME: <u>10:30</u>	0.00 0.00				<u>1</u>		<u>15-10-23</u>	DAS 34 9-89

DQA:

Date:

16/02/04

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed:

Date:

16/02/03

Work Order update only ☐

Work Order: <u>137559</u> Part No. <u>D19-646-041</u> NCR No. <u>16-5571</u>		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Cross tube ☐ Water Jet ☐ Engineering ☒ Machining ☐ Small Fab ☐ Prod. Eng. Coord. ☐ Quality ☐ Thermoforming ☐ Finishing ☐ Rec/Store/Packaging ☐ Other ☐ Large Fab ☐ Composite ☐ Supplier ☐							
Date: <u>15.10.06</u>		Step #: <u>200</u>		QTY Effective: <u>1</u>			MRB (QSI042) Approval <u>A.P.</u>				
Description Work Order Deviation				Disposition				<u>15.10.06</u>			
• NO POWDER COAT ON SADDLE LOCATIONS IN ACCORDANCE WITH ATTACHED DWG, ALODINE ONLY. • UNUSED WEARPLATE HOLES SHOULD BE PLUGGED WITH AN3CYA BOLTS				ACCEPTABLE AN3C-4A/M13340 (x4) 16/01/12 16-01-18.				Completed By <u>16/01/12</u> Lead hand / Supervisor Approval Verification DAS 9 9-89 <u>16-01-16</u> QC / QA Coordinator Approval DAS 9 9-89 <u>16-01-16</u>			
Root Cause Environment ☐ No Re-verification ☐ Design ☐ Operator ☐ Doc/Data ☐ Offset/Setup ☐ Equip/Tooling ☐ Supplier ☐ Handling/Pre ☐ Training ☐ Material ☐ Use for Testing ☐ Internal Transport ☐ Poor Information ☐ Tribal Knowledge ☐ Rushing ☐ LOA ☒ Product Improvement ☐ Substation ☐ Process Improvement ☐ Past Expiry Date ☐ Manufacturing Process ☐ Misidentified ☐ Past Due ☐				FAULT CATEGORY Pressure/Forced ☐ Temperature/Cure ☐ Power Loss/Surge ☐ Positioned Wrong ☐ Bending ☐ Set-up ☐ Folio/Program ☐ Outside Dimensions ☐ Centre Not Concentric ☐ BOM/Route ☐ Grain ☐ Over/Under tolerance ☐ Cracks ☐ Broken/Damage/Defect ☐ Weld ☐ Part Incorrect ☐ Crimp/Kink/Ripple/Wave ☐ Inspection Incomplete/Unqualified ☐ Wrong Stock Pulled ☐ Part Lost/Missing ☐ Cuffs ☐ Contamination ☐ Out of Sequence ☐ Part Moved ☐ Crushing ☐ Countersink ☐ Off-set ☐ Drawing ☒ Heat Treat ☐ Cut Too Short ☐ Misabeled ☐ Finish ☐ Wave/Twist in Tube ☐ Instructions Incomplete/Unclear ☐ Fit/Function ☐ Misread ☐ Marks/Chatter ☐ Drill Holes ☐ Misaligned/off center ☐ Turning Sequence ☐				OTHER: ☐			

Tuesday, October 06, 2015 12:41:55 PM

137559

Page 9

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 11/16/15 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 11/27/15 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Run Start *NR1*

Stop ***NR2***

Approvals: **Process Plan:** _____ **Date:** **Tooling:** **Date:**

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210 QC3- Inspect Part Finish

0.00

210

QC Memo

0.00

Quality Control

220	0.00
-----	------

220

HandFinish Memo

Hand Finishing — 1-Install inserts as per Dwg D3887.

230	QC5- Inspect part completeness to step on W/O	0.00
-----	---	------

230

QC Memo

Quality Control

**DAS
15
9-89**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

Work Order ID 137559

Tuesday, October 06, 2015 12:41:55 PM

137559

Page 10

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 11/16/15 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/27/15 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240									
HandFinish	Memo	0.00							
Hand Finishing	1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers A/R Sikaflex-240/-291 <u>11133136</u> Sikaflex expire date: <u>16111</u>								
	2-assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: <u>14131349</u> RTV 598 <u>1413275</u> 17/02								
	3 -Inspect for foreign objects as per OSI 024								
	4 -Install Aft Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 <u>120132136</u> Sikaflex expire date: <u>16112</u>								
245	QC5- Inspect part completeness to step on W/O	0.00							
245									
QC	Memo	0.00							
Quality Control									

DAS
38
9-89

OCT 20 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Tuesday, October 06, 2015 12:41:55 PM

Item ID: D119-646-041

Accept

N900040100

Setup Start *NS1*

Revision ID: URF15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop *NS2*

Start Date: 11/16/15 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 11/27/15 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center ID

Operation Description

Set Up/ Run Hours

Tool ID	Tool #	Plan Code
---------	--------	-----------

Accept Qty	Reject Qty	Reject Number	Insp. Stamp

250

Wing Walk as per dwg QSI005 4.4 Batch 141330009

250

HandFinish

Memo

0.00

Hand Finishing

251

QC3- Inspect Part Finish

0.00

251

OC

Memo

0.00

Quality Control

260

Identify as per dwg & Stock Location:

0.00

260

Packaging

Memo

0.00

Packaging

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

Work Order ID 137559***137559***

Page 12

Tuesday, October 06, 2015 12:41:55 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 11/16/15 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/27/15 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270	QC21- Final Inspection - Work Order Release	0.00							
270									
QC	Memo	0.00							
Quality Control									

ML5 JAN 12 2016

ML5 JAN 12 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Picklist Print

Tuesday, October 06, 2015 12:42:05 PM

Page 1

Work Order ID: 137559

137559

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15

Required Date: 11/27/15

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC
10.02.22 per PAR 09-043 EC verified by:DD IPP rev B
(DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 13.03.20 per
chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-190 *D2500-1-190* Ext'n -I' Beam Tube 4"		Manufactured	No			110	Each	52.0000	1	1			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				HALL		52							
				134259		52							
D2579 *D2579* Crossbolt Spacer		Manufactured	No			140	Each	55.0000	2	2			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				LG001		55							
				123997		55							
D2855-3 *D2855-3* Cap		Manufactured	No			240	Each	9.0000	2	2			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				FP001		9							
				133972		5							
				134938		4							

**

**

**

15-10-7

1

15-10-15

15/10/27

B135830

X2

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Tuesday, October 06, 2015 12:42:05 PM

Page 2

Work Order ID: 137559

137559

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15

Required Date: 11/27/15

Start Qty: 1.00

Required Qty: 1.00

NAS1611-005

Purchased

No

240

Each

312.0000

16

16

NAS1611-005

O-RING

Location

Loc Qty

Loc Code

FP001

312

m129198

75

m129384

55

m133039

100

m133077

82

x11

5

D3492-5

Manufactured

No

240

Each

93.0000

16

16

D3492-5

Plug

Location

Loc Qty

Loc Code

FP

2

133396

2

FP001

91

120153

15

133909

12

136351

64

x16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Tuesday, October 06, 2015 12:42:05 PM

Page 3

Work Order ID: 137559

137559

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15

Required Date: 11/27/15

Start Qty: 1.00

Required Qty: 1.00

D3672-1 Manufactured No

240 Each 844.0000 2 2

D3672-1

Washer, Phenolic

ell vs 11/10/27

Location	Loc Qty	Loc Code
FG	10	
85222	10	
FP001	48	
113581	48	<i>X2</i>
ST049	783	
112218	72	
127322	211	
134785	500	
ST055	3	
120116	3	

D3681-1 Manufactured No

160 Each 32.0000 8 8

D3681-1

Spacer

*BE15-10-15
B 137757 x4*

Location	Loc Qty	Loc Code
LG001	32	
132711	1	
133987	11	
135920	20	<i>4</i>

D3847-1 Manufactured No

240 Each 4.0000 5 5

D3847-1

Wearpad

ell vs 11/10/27

Location	Loc Qty	Loc Code
FP001	4	<i>B 136564</i>
135515	4	<i>B 135521</i>

*X2
X3*

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Picklist Print

Tuesday, October 06, 2015 12:42:05 PM

Page 4

Work Order ID: 137559

137559

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15

Required Date: 11/27/15

Start Qty: 1.00

Required Qty: 1.00

D3847-11	Manufactured	No	240	Each	10.0000	1	1	
D3847-11								**
Wearpad								<u>all 12/10/27</u>

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FP001	10	
135077	10	

D3885-1	Manufactured	No	140	Each	5.0000	1	1	
D3885-1								**
Standard Web								<u>15-10-8</u>

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
LG002	5	
135289	5	

D3903-1	Manufactured	No	160	Each	74.0000	12	12	
D3903-1								**
Spacer								<u>BE 15-10-15</u>

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
LG001	74	
124312	3	
135316	2	
136906	69	

ALS4-1032-130	AEIS4-1032-130	Purchased	No	220	Each	4,232.000	30	30
ALS4-1032-130								**
Rivnut								<u>all 12/10/27</u>

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
CCK004	4232	
M133077	4232	

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QS1042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

Picklist Print

Tuesday, October 06, 2015 12:42:05 PM

Page 5

Work Order ID: 137559

137559

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15

Required Date: 11/27/15

Start Qty: 1.00

Required Qty: 1.00

AN3C5A

Purchased

No

240

Each

595.0000

32

32

AN3C5A

Bolt

all 11/16/15

Location

Loc Qty

Loc Code

FG

5

122800

5

FP001

268

M132930

268

x32

ST338a

72

M131803

8

M132640

64

ST350

250

M133234

250

NAS1149C0332R

Purchased

No

Each

5,761.000

32

NAS1149C0332R

WASHER

all 11/16/15

Location

Loc Qty

Loc Code

FP001

1004

m132930

1004

FP01

1871

m133284

1871

x32

GA

444

m133284

444

ST271

2442

m133284

2442

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐				

Picklist Print

Tuesday, October 06, 2015 12:42:05 PM

Page 6

Work Order ID: 137559

137559

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 11/16/15

Required Date: 11/27/15

Start Qty: 1.00

Required Qty: 1.00

MS24694-C52

Purchased

No

Each

51.0000

2

MS24694-C52

all 11/16/27

SCREW

Location

Loc Qty

Loc Code

FP001

17

m127059

17

ST287

34

124308

34

XZ

DQA: _____ Date: _____


**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

8 7 6 5 4 3 2 1

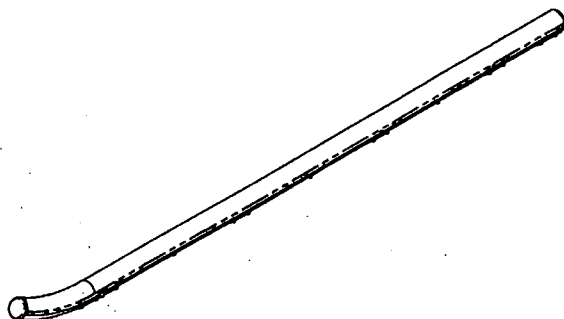

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2679	CROSS BOLT SPACER
11	2	2	2	D2856-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3672-1	PHENOLIC WASHER
14	8	8	8	D3681-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3903-1	SPACER
28			16	D3904-1	WASHER
41	30	30		AL84-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C46A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN880C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24694-C52	SCREW

RELEASED

UNDER REVIEW

15.04.30 URF15-560 AP

2014 NOV 24

ECN 14-028

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241-291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO Ø0.197 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARPLATE INSERTS. INSTALL AELS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241-291.

15-10-06
137559

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 135.07 WAS 134.04 (ZN D5-8), ADD 5.07 (ZN C2-9), ADD 116.8 (ZN D5-8), DELETE GASKETS (BOM, SH2)	DB	13.09.20
C	(SHT1) P/L ZN C2-2, C3-2, C4-2, ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24694-C52 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) Ø0.201 CSK Ø0.365 X 100" WAS Ø0.214 THRU, ADD DETAIL F (ZN C5-5, C6-8, B6-7), ADD ITEM 10, D2579 CROSS BOLT SPACER (ZN D4-1, A8-7)	DB	13.02.19
B	AL84-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7); ADD DT8931 (ZN A8-1); ADD 134.04 (ZN C4-8); D2856-3 WAS D2679 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C6-2, C2-2, C6-3, C5-3, C6-4, C2-4); Ø0.313 WAS Ø0.328 (ZN C4-5, C4-5, C2-7 & B3-7) REVISED NOTE IV (ZN B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF		
DRAWN	DB		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	13.09.20		

DART AEROSPACE USA, INC.
KENT, WA

DRAWING NO. D3887
REV. D
SHEET 1 OF 8
SCALE
NTS

COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE TO THE PUBLIC. NO OTHER RIGHTS ARE RESERVED. NO OTHER RIGHTS ARE RESERVED.

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

AN3C5A BOLT
NAS1149C0332R WASHER
24 PL

PLUG UNUSED INSERTS WITH
AN3C5A BOLT
NAS1149C0332R WASHER
8 PL

D3847-1
WEARPAD
5 PL

MS24894-CS2 SCREW
(1 PER SIDE)

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

2.00 DISTANCE TO D3885-1 WEB, REF

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24

DESIGN	RF	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	DB		
CHECKED		DRAWING NO. D3887	REV. D
MFG. APPR.			SHEET 2 OF 8
APPROVED		TITLE A119 STD SKIDTUBE ASSY	SCALE NTS
DE APPR.		COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE OPEN SOURCE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DATE	13.09.20		

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3C5A BOLT
NAS1149C0332R WASHER
30 PL

BLACK ANTI-SKID TO 0.6
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3CSA BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

AN3C46A BOLT
D3904-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

1.5 1.5 1.5 1.5

1.5 1.5 1.5

2.00 DISTANCE TO D3885-1 WEB

1.5 D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24894-C52 SCREW
(1 PER SIDE)

D3849-041
FWD TRAINING WEARPLATE ASSY

UNDER REVIEW


15.04.30 URF15-560 AP


RELEASED

2014 NOV 24 *q*

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D3887	REV. D
MFG. APPR.	<i>[Signature]</i>	SHEET 4 OF 8	
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

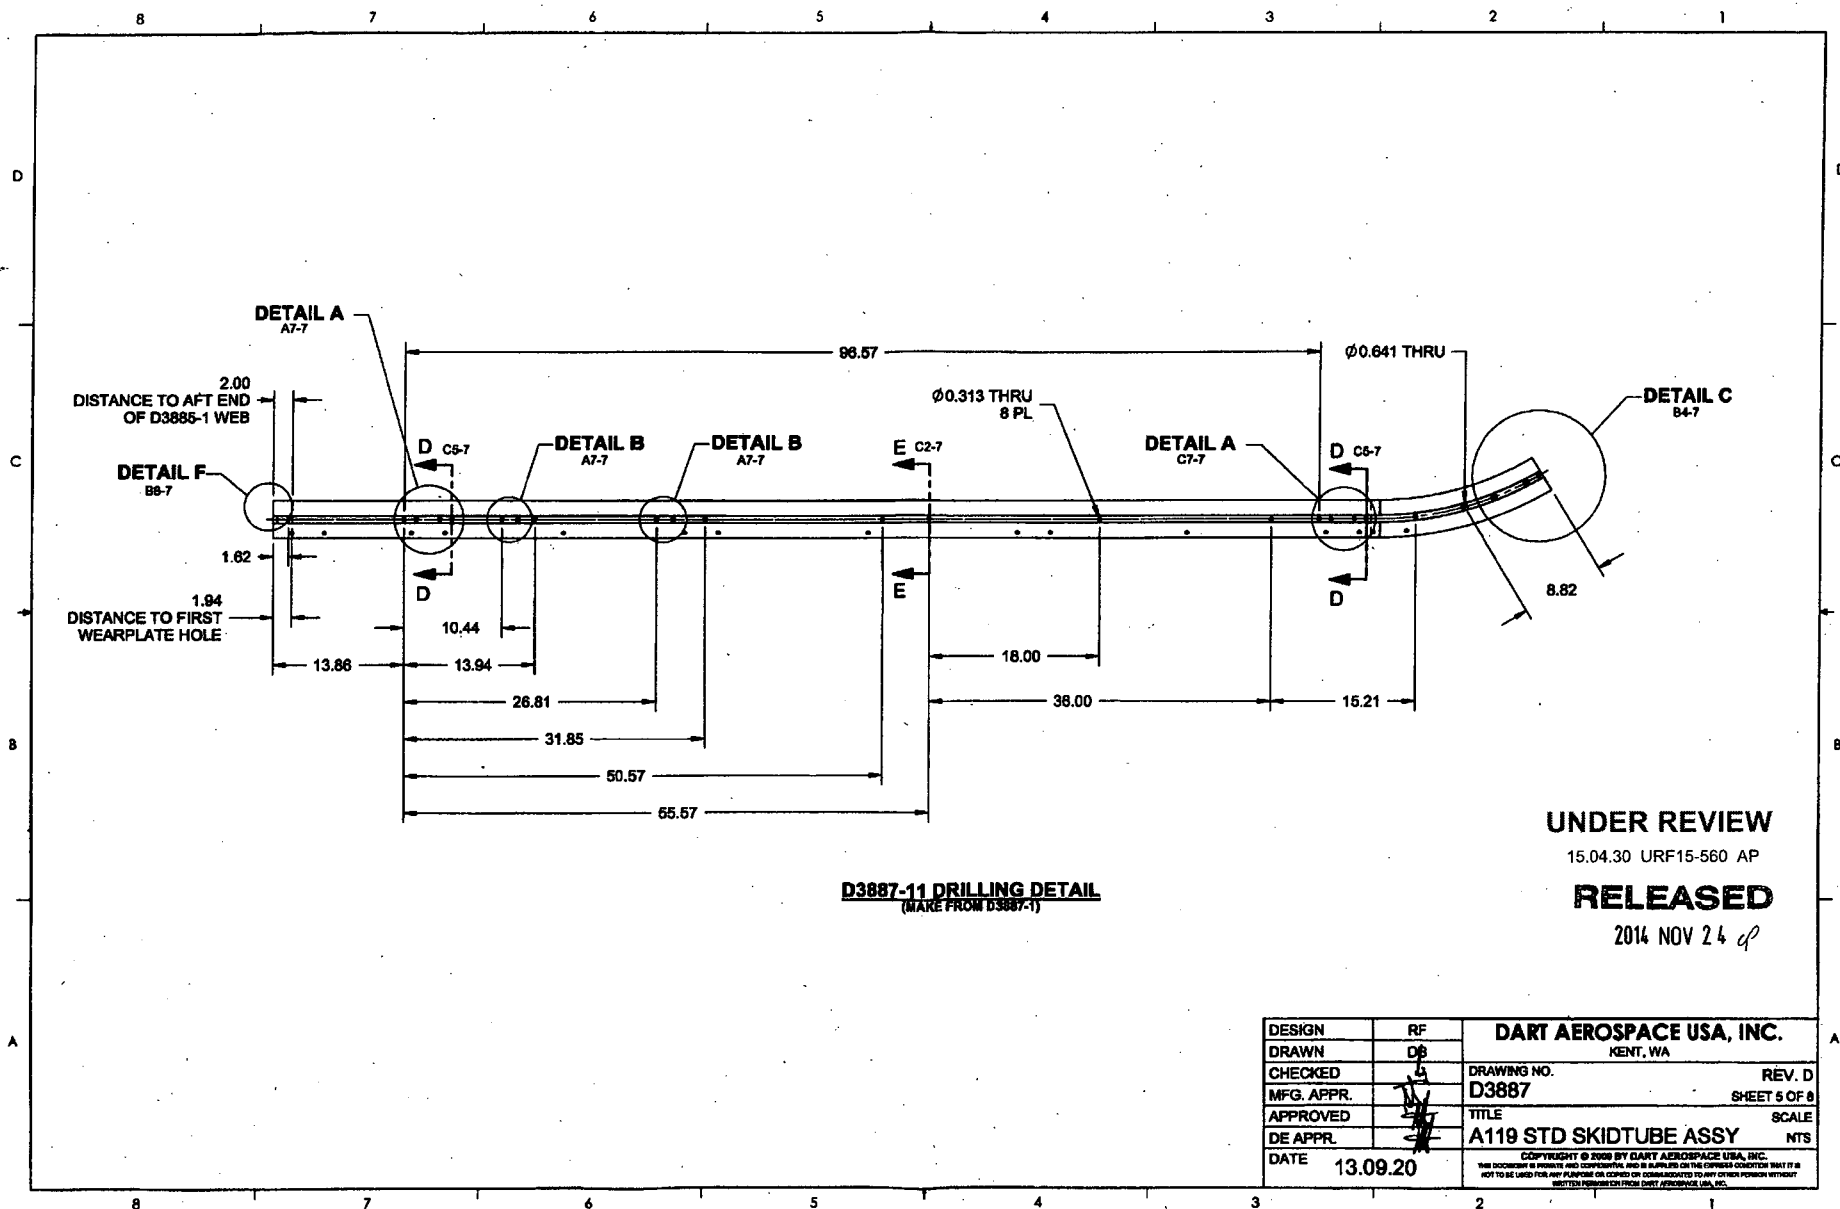

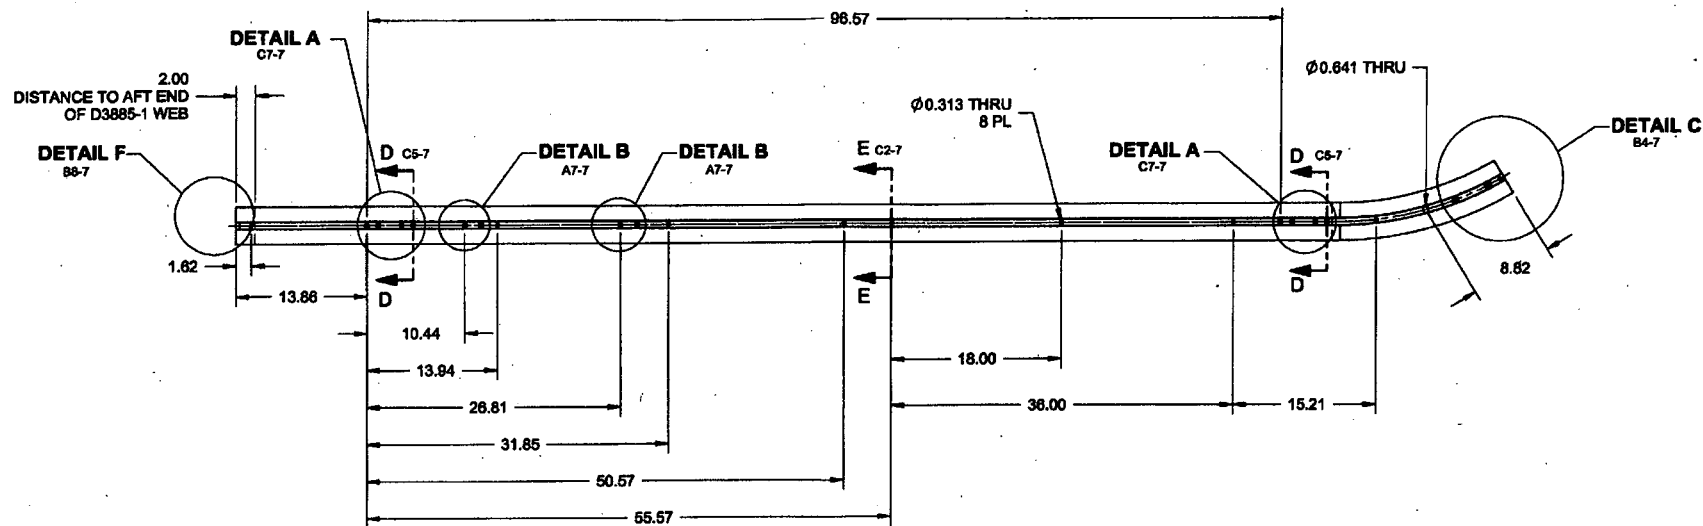

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED


2014 NOV 24 *ap*

DESIGN	RF	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	DB		
CHECKED	<i>[Signature]</i>	DRAWING NO. D3887	REV. D SHEET 8 OF 8
MFG. APPR.	<i>[Signature]</i>	TITLE A119 STD SKIDTUBE ASSY	SCALE NTS
APPROVED	<i>[Signature]</i>	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE REPRODUCED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DE APPR.	<i>[Signature]</i>		
DATE	13.09.20		

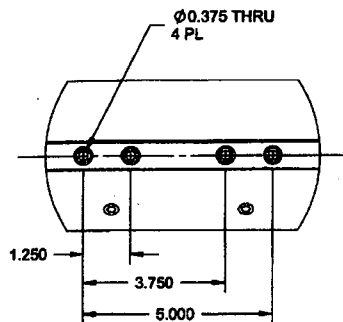


DETAIL A
SCALE 4X

D7-5
C3-5
D7-6
C3-6

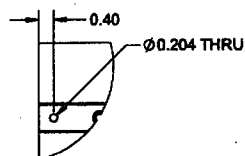


DETAIL F
SCALE 4X

C8-5
C8-6

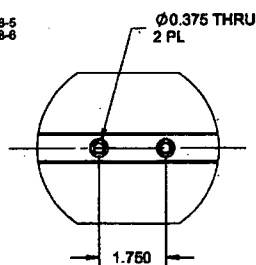

DETAIL B
SCALE 4X


C8-5
C5-5
C8-6
C5-6

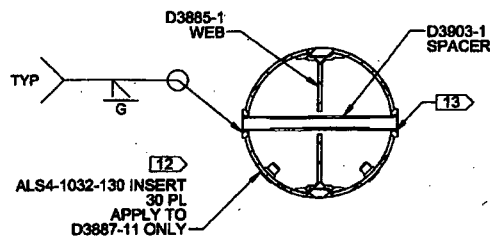

SECTION D-D
SCALE 4X


(FOR 12 X Ø 0.375 HOLES
PER SKIDTUBE)

C7-5
C3-5
C7-6
C2-6

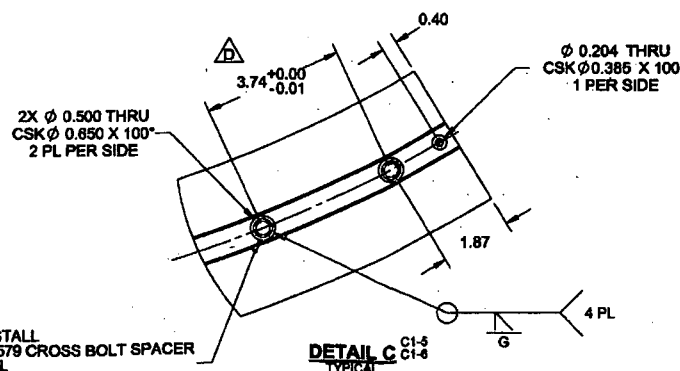

DETAIL C
TYPICAL
SCALE 4X

C1-5
C1-6

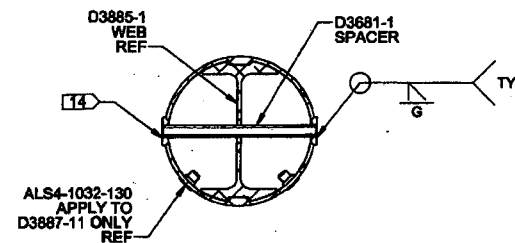

SECTION E-E
SCALE 4X
(FOR 8 X Ø 0.313 HOLES
PER SKIDTUBE)

C4-5
C4-6

NOTES:

13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø 0.375 HOLES ONLY:

- i) CHAMFER HOLES Ø 0.475 x 45°
- ii) INSERT D3903-1 SPACER
- iii) WELD INTO PLACE AND GRIND FLUSH
- iv) CBORE TO 0.313 x 0.75 DEEP
- v) DEBURR HOLES

14) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø 0.313 HOLES ONLY:

- vi) CHAMFER HOLES Ø 0.354 x 45° OR 0.050 DEEP x 45° (BOTH SIDES)
- vii) INSERT D3681-1 SPACER
- viii) WELD INTO PLACE AND GRIND FLUSH
- ix) DEBURR HOLES


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 q?

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	5	DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR REPRODUCED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

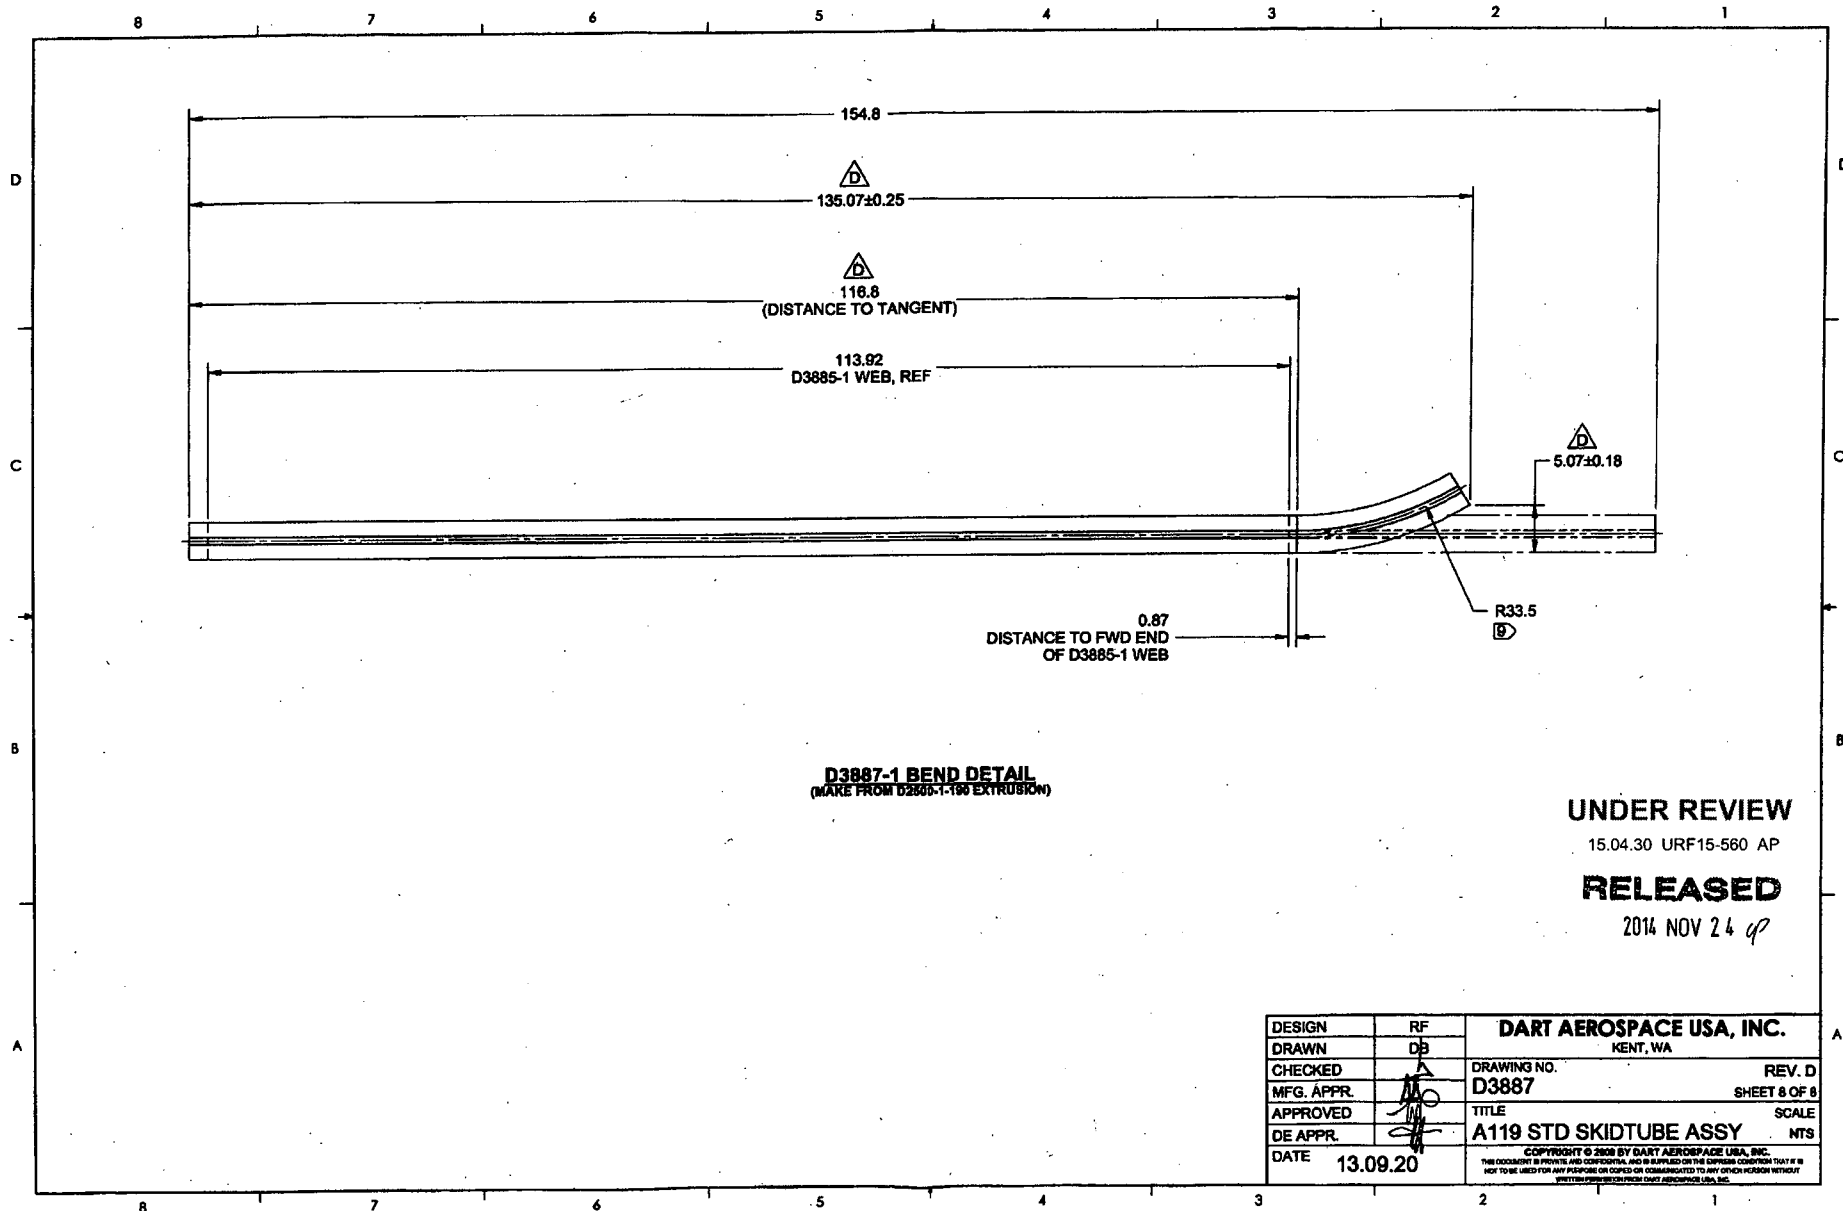


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

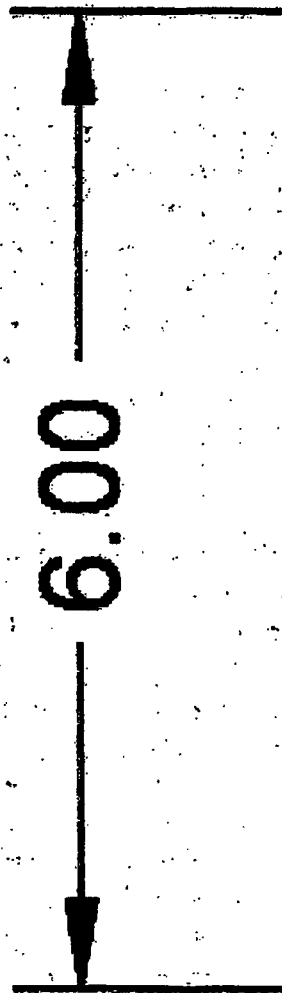

A.P.
15.05.29

